

Important Notice

This technical report is based on a visual inspection of the vehicle. A detailed assessment of the driveline is not included. As such, the report is not comprehensive, and no rights can be derived from its contents.



Renault T 520 6X2

317.211 km 520 hp Euro 6 Automatic

Reference number
70287845

Date of first registration
15-Dec-2017

VIN number
VF611M367JD000816

General

We check whether the vehicle requires maintenance and if a service history is available.

Description	Status	Details	Price
Service logbook available	No Service recommended	Recommended service	
		Complete Service (Engine oil + all filters)	€ 995.00
		Gearbox & differential service (4x2 6x2)	€ 375.00
Engine hours	Not possible to note engine hours from display		

Drivetrain

We inspect the drivetrain components, including the engine, transmission, driveshaft, and axles, for wear, leaks, and mechanical issues.





Description	Status	Details	Price
Condition engine	Operational		
Condition coolingsystem	Operational		

Drivetrain

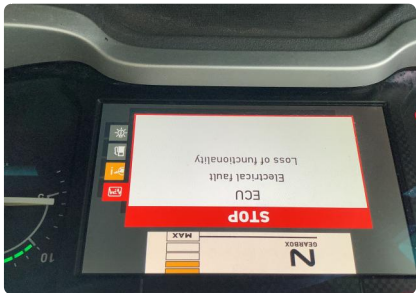




Description	Status	Details	Price
Condition exhaust	<div></div> Operational		
Condition gearbox	<div></div> Operational		
Condition driveshaft and differential	<div></div> Operational		
PTO preparation	<div></div> Yes		
Condition hydraulic system	<div></div> Operational		

Cabin


We assess the overall condition of the cabin, both interior and exterior. All notable issues are detailed.

Description	Status	Details	Price
Interior condition	<div></div> Needs attention The buttons to operate the screen do not work the top board has an empty compartment the horn is not working The windshield wipers do not inject water	Recommended service Mount cover	€ 35.00
<div><div></div><div></div><div></div><div></div></div>			
Webasto heater	<div></div> Needs attention the webasto system does not work	Recommended service Repair or change Webasto unit	€ 500.00
Auxiliary airco	<div></div> N/A		
Airconditioning	<div></div> Operational		

Cabin


Description	Status	Details	Price
Dashboard codes	<div><div></div><div>Needs attention</div></div> <div>The buttons for display operation do not work Fault codes in the display</div>		
			
Condition tacho	<div><div></div><div>Operational</div></div>		
Condition windows	<div><div></div><div>Operational</div></div>		
Condition exterior	<div><div></div><div>Needs attention</div><div>The front cover has a dent on the right side The back of the right headlight does not have a cover the right bumper does not have a cover the right door has a dent</div></div>	<div>Recommended service</div> <div>Replace frontpanel Mount cover Mount cover</div>	<div>€ 1495.00 € 75.00 € 55.00</div>
<div></div>			
Condition locks	<div><div></div><div>Operational</div></div>		

Cabin

Description	Status	Details	Price
Spare key	<div><div></div>Yes</div>		
			




Chassis

The exterior of the chassis and all components, such as tires, suspension, lighting, and batteries, are inspected. All notable issues are reported.

Description	Status	Details	Price
Condition chassis	<div><div></div>Operational</div>		
Lights	<div><div></div>Needs attention the left rear light is broken</div>	<div>Recommended service Replace rearlight glass leftside</div>	€ 65.00
			
Condition suspension	<div><div></div>Operational</div>		
Condition airtsystem	<div><div></div>Operational</div>		
Condition batteries	<div><div></div>Needs attention the batteries are weakened 225Ah</div>	<div>Recommended service Mount new batteries 225 ampère VARTA</div>	€ 500.00
Conditon tyres	<div><div></div>Needs attention</div>	<div>Recommended service New front axle tyres available from (Per piece - incl. service cost) New rear axle tyres available from (Per piece - incl. service cost)</div>	<div>€ 330.00 € 320.00</div>

Axles and brakes

We check the condition of the brakes and axles. All notable issues are reported.

Description	Status	Details	Price
Condition and wear brakes Axle 1			
Condition and wear brakes Axle 2			
Condition and wear brakes Axle 3			

Service & warranty



Maintenance contract for maximum peace of mind on the road

Custom paintwork



Customised paintwork in your brand or desired colours

Import & Documentation



Full support for import and documentation processes.

Tow Bar



Expand functionality with a durable tow bar.

Reversing Camera



Safer manoeuvring with a reversing camera.

Tyres & rims



Choose rims and summer, winter, or all-season tyres for superior performance

Additional Work Lights



Improve visibility and safety with extra work lights

Interested?

BAS World offers a wide range of services to ensure your vehicle performs at its best. Would you like to learn more about this vehicle or our services?

About

Inspection date
14-Jul-2025

Contact Us

Your personal BAS World advisor is ready to answer your questions in your own language. Contact us by phone, email or via our website (scan the QR code).

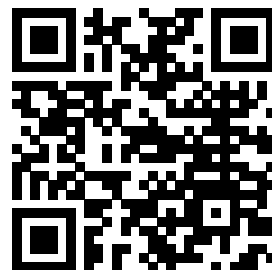


BAS World Sales

+316 346 693 43

sales@basworld.com

We support the following languages



Scan to contact us